




- ● TGM auf der Rückseite aufschrauben und durch leichtes hebeln Richtung Kabel öffnen



- Oberen Gehäuseteil durch leichtes Hebeln nach Vorne vorsichtig (Achtung Kabel zur vorderen Buchse) lösen

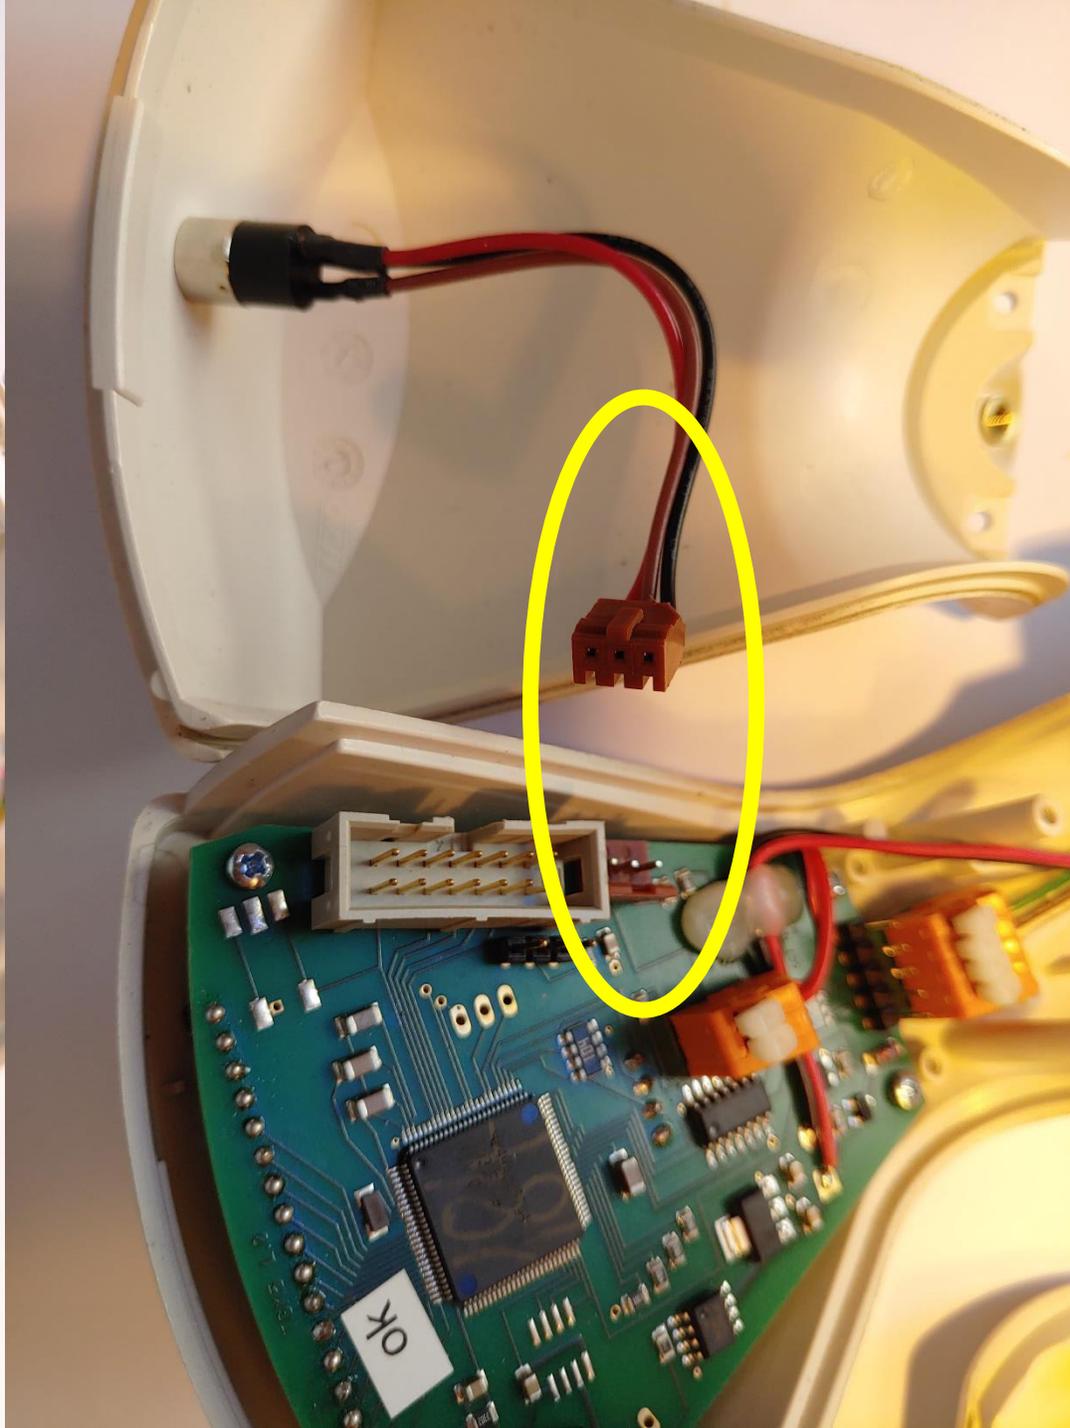

- ● Buchsenanschluss lösen

Standard


Weiß

Braun

Grün


Gelb

email@glasmacher-electronic.de

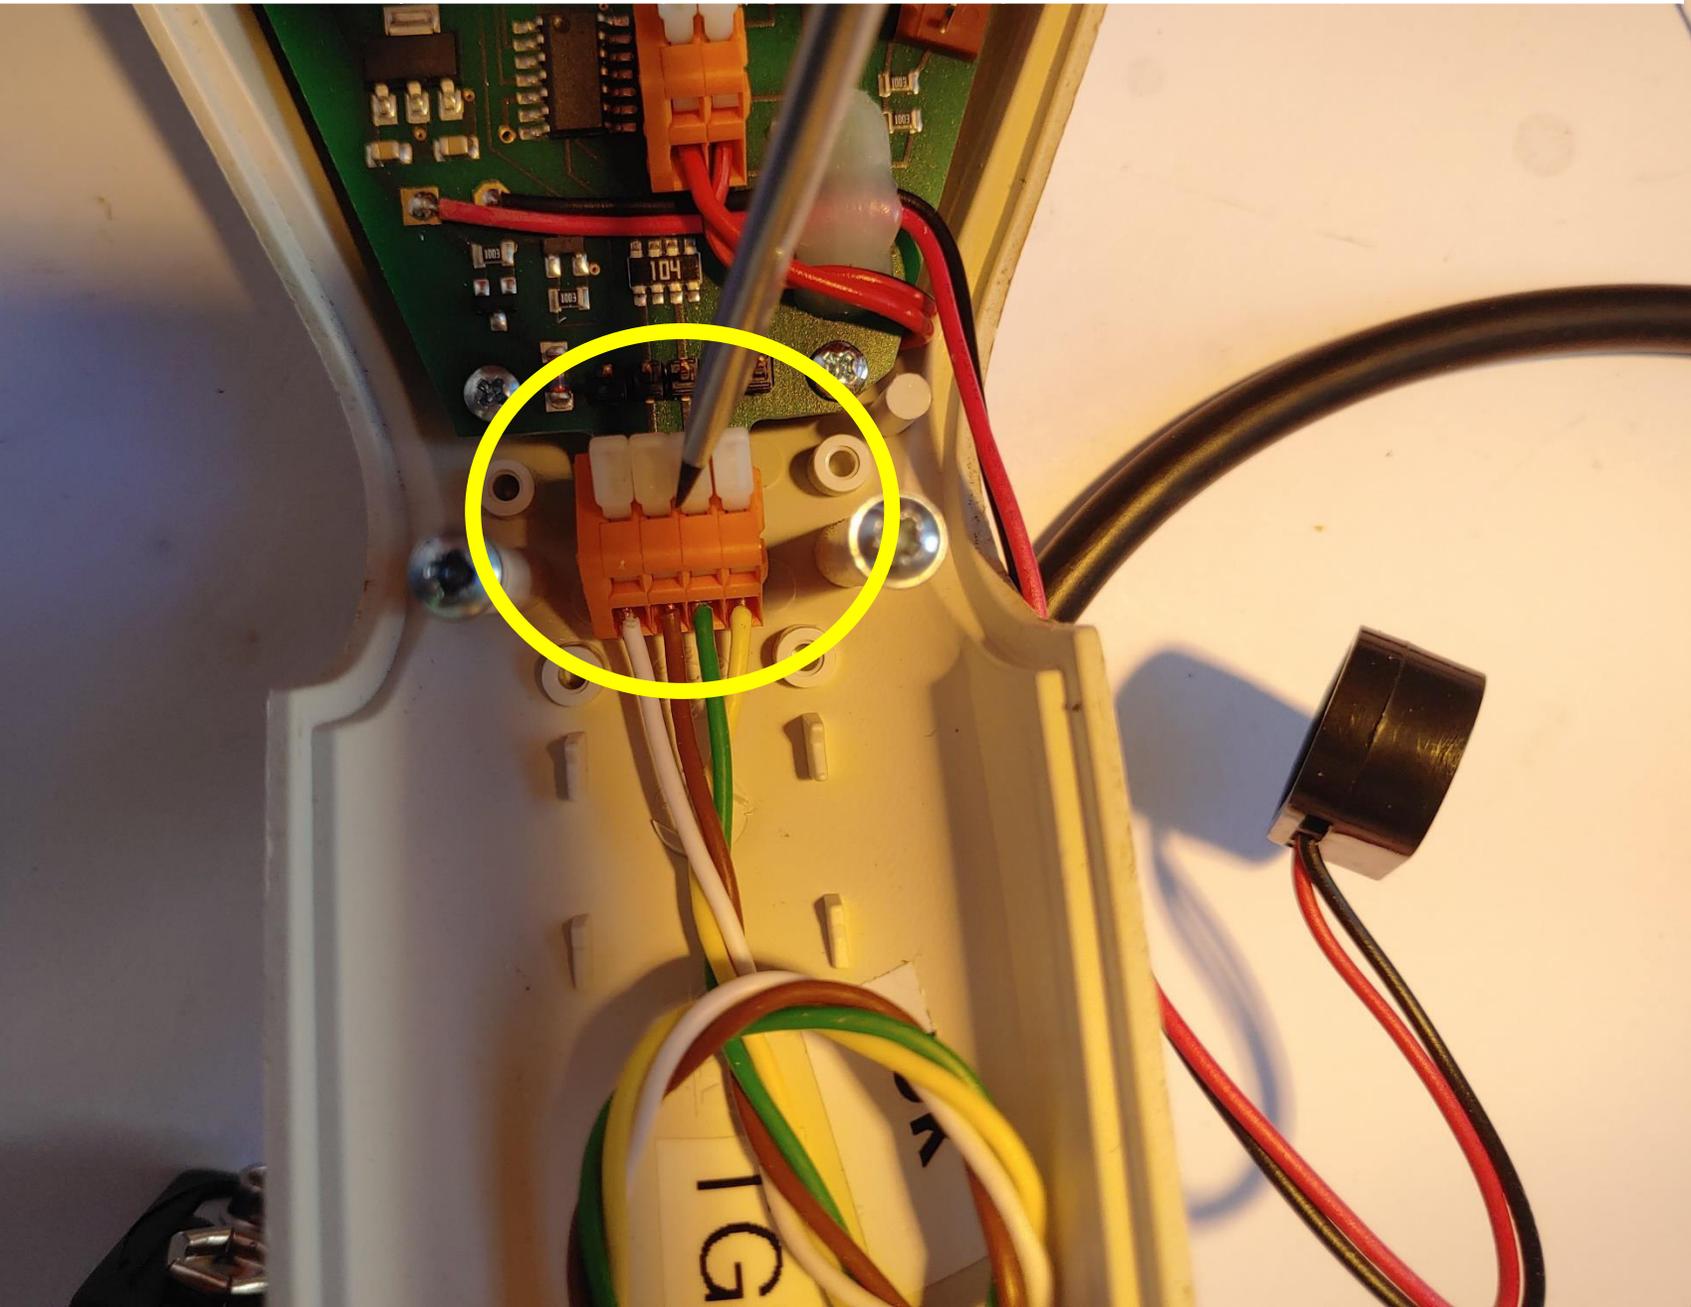

- Sollte so aussehen
- Von links nach rechts:
 - Weiß
 - Braun
 - Grün
 - Gelb


Durch Druck auf den weißen Hebel und vorsichtigen Ziehen mit einer Pinzette das braune und grüne Kabel aus der Klemme ziehen

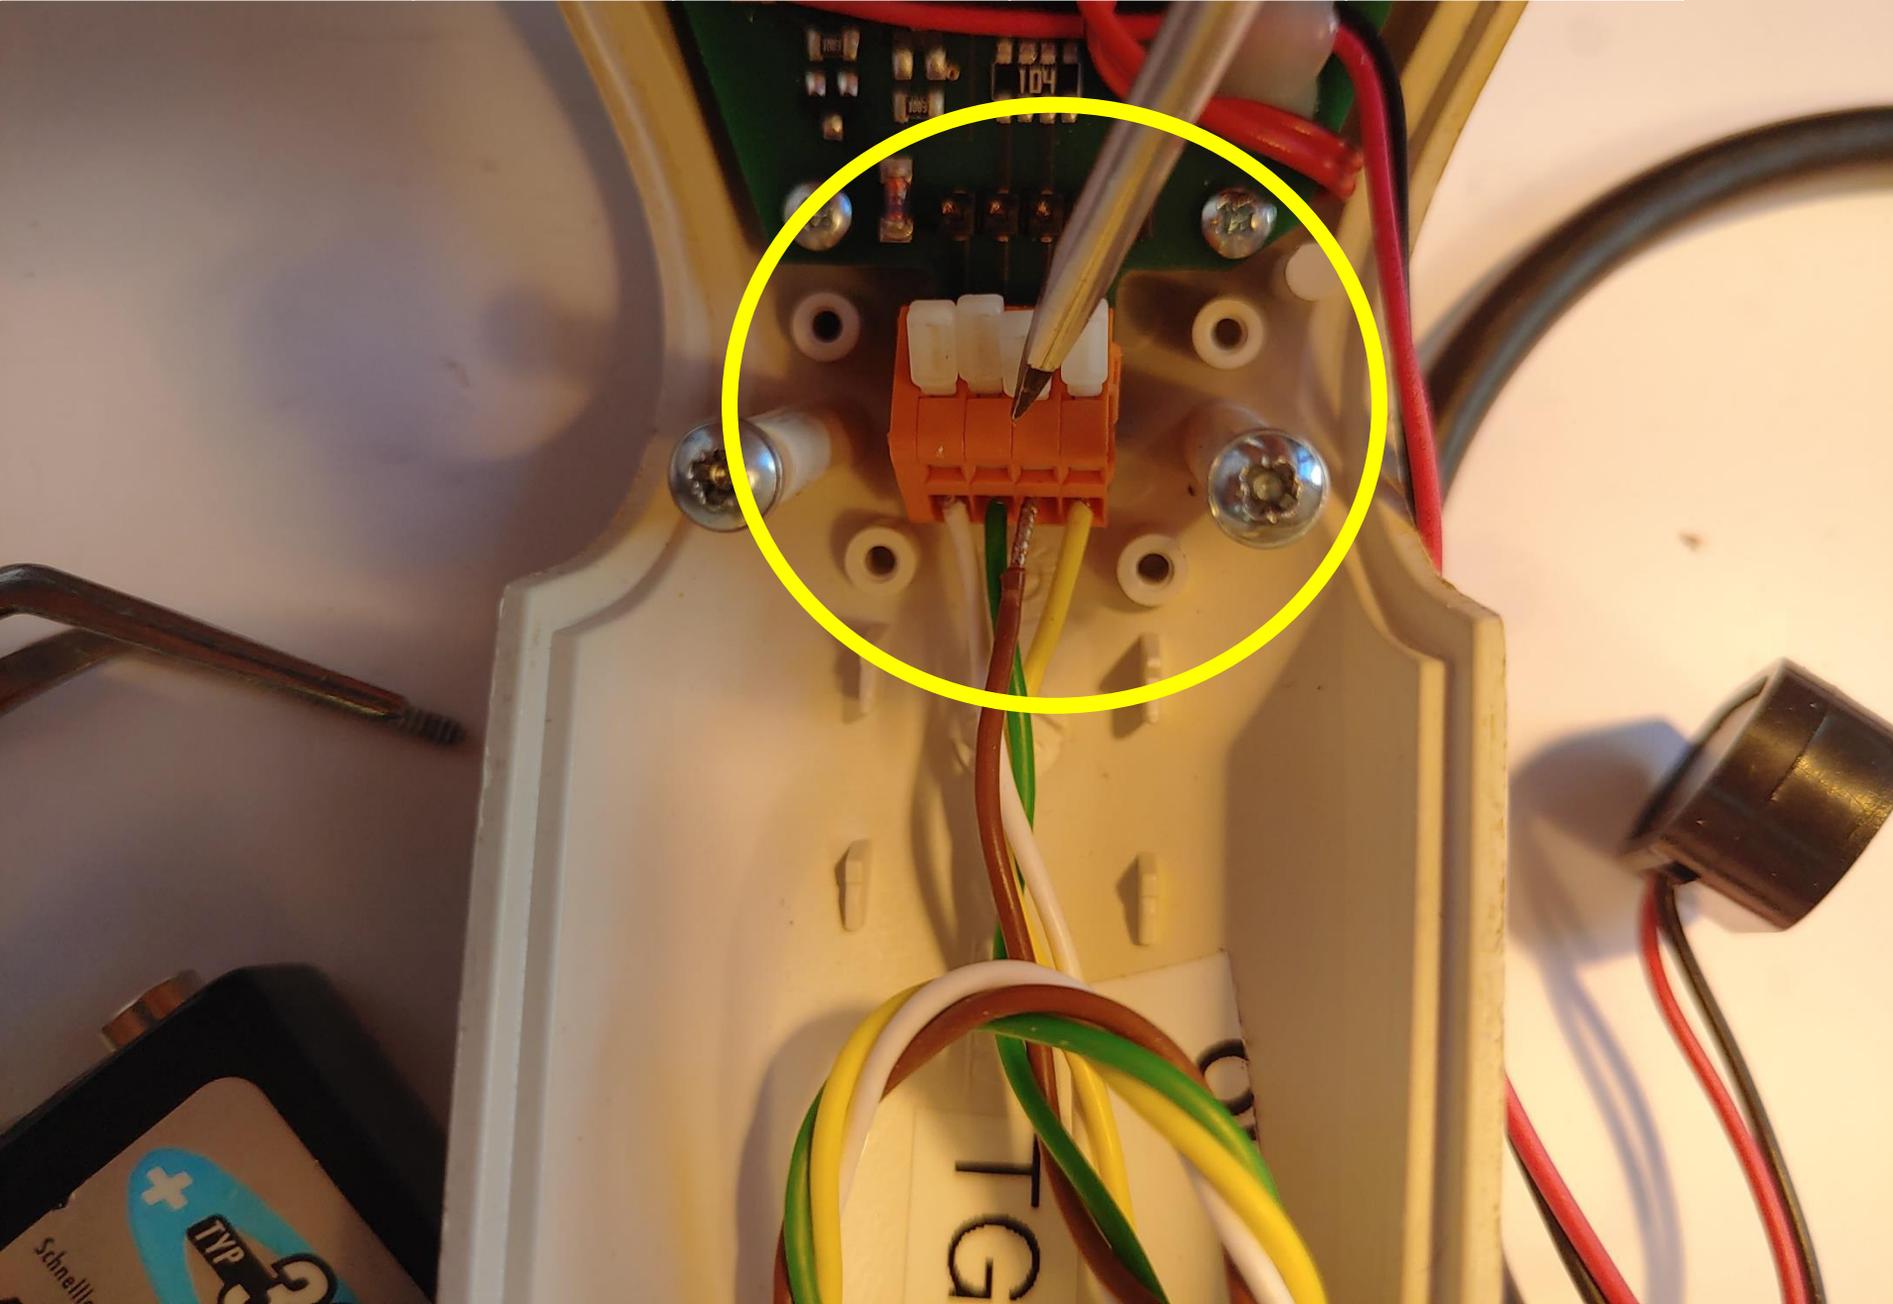

- Grüne Kabel neben weißen Kabel
- Braune Kabel neben gelben Kabel
- Durch vorsichtiges Drücken der weißen Hebel und mit Hilfe einer Pinzette wieder mit der Klemme verbinden

Open the measuring device

- Check the terminal block: if you pushing the white lever down the cable is loose – please use ferrules or tin the stripped cable
- Check the cable grommet often the glue gets loose we recommend a special glue for TPE (for example Loctite)

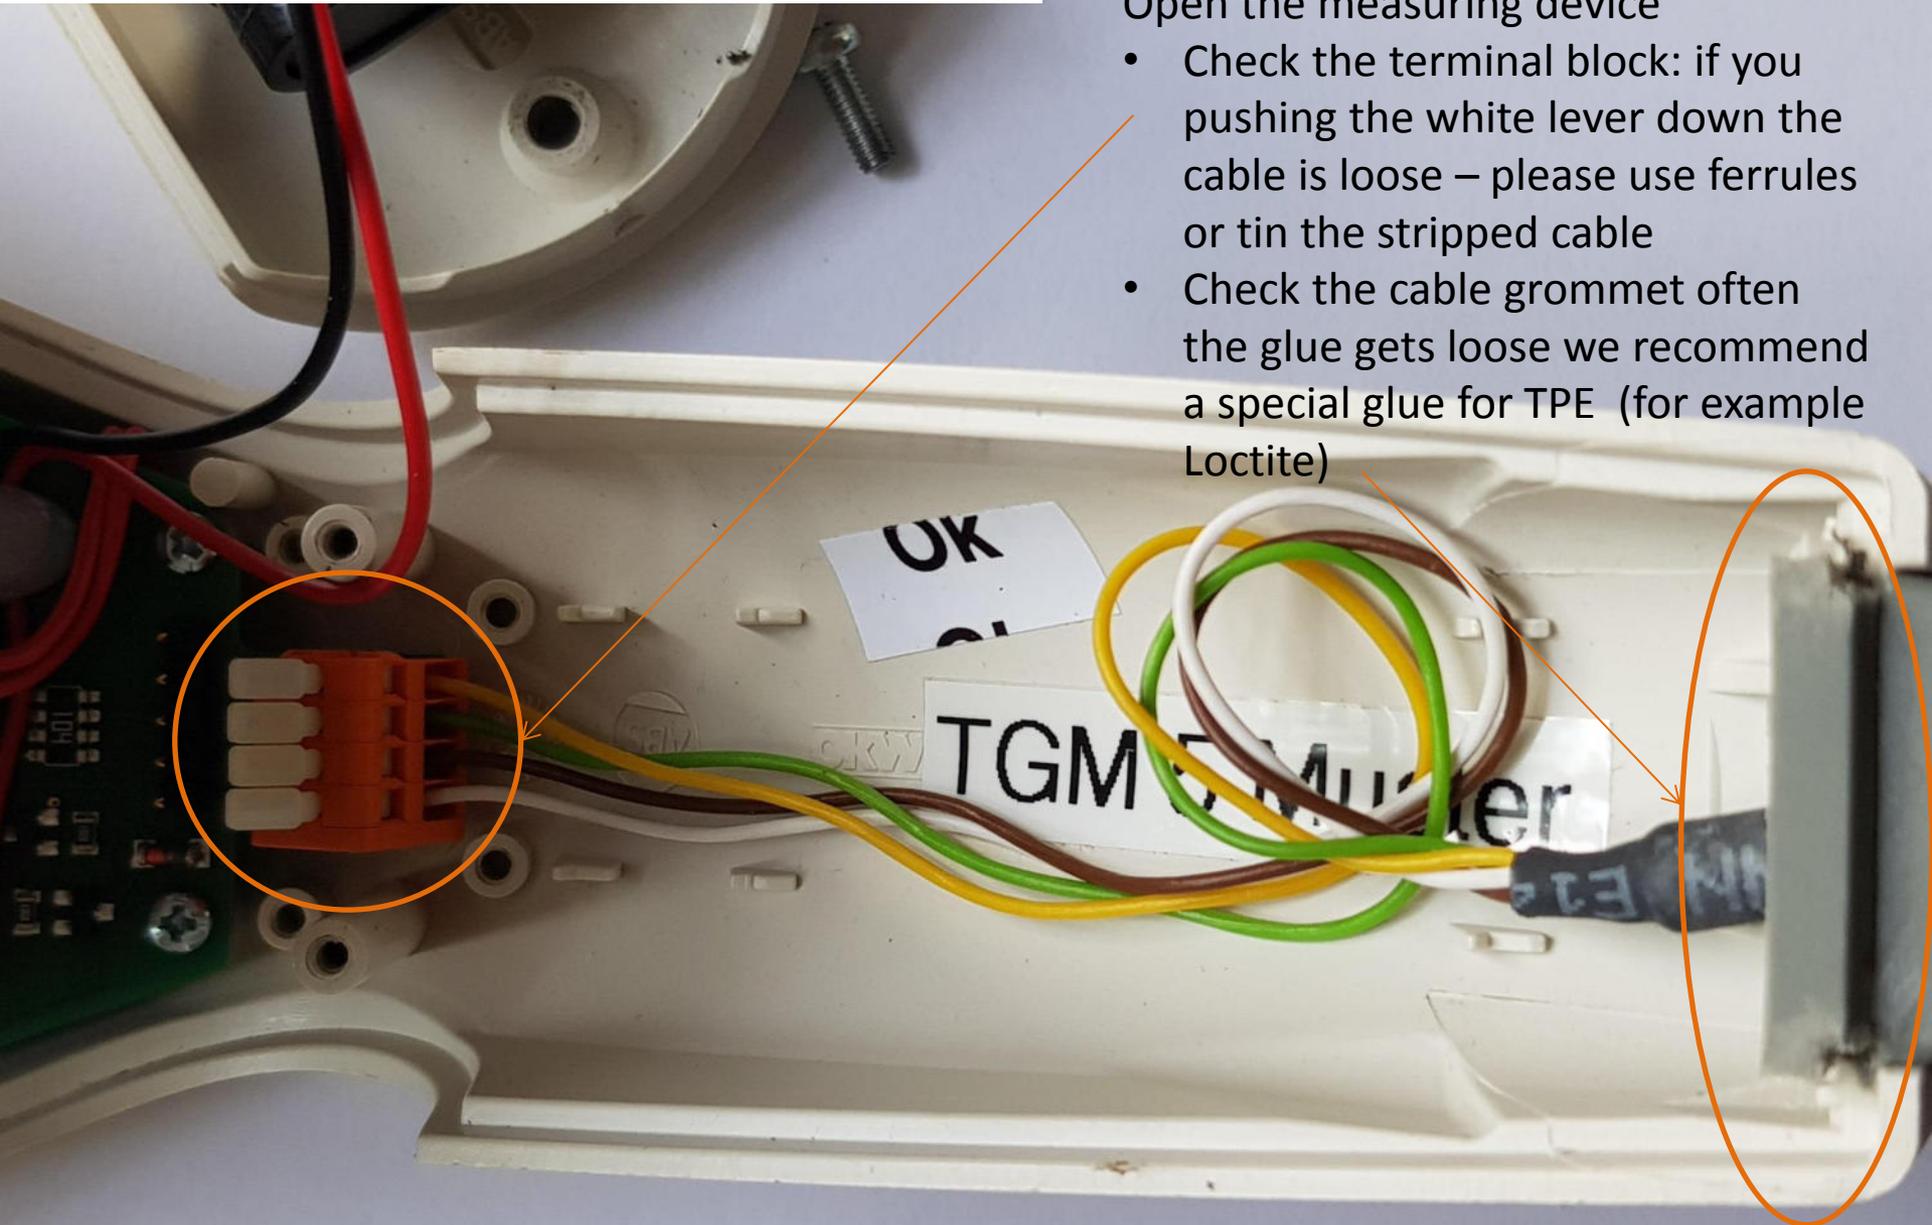

PLEASE DISCONNECT THE BATTERY IMMEDIATLY AFTER OPENING



Because of repeated problems with the cable grommet we changed it in early 2018 from glueing to clamping – please contact email@glasmacher-electronic.de so we can change for you in Germany or send you the metall clamp free of charge so you can change